


[Click here to print](#)

Connector: **C0047L**

CONNECTOR HOUSING NOT SERVICEABLE

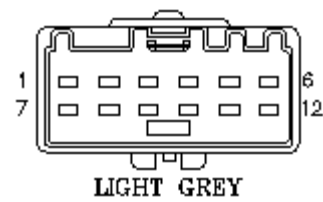

Part No.: **YPC911790**

Colour: **LIGHT GREY**


Cavities: **12WY**

Harness: **CABIN HARNESS**

Description: **Main harness to instrument panel harness**

Location: **Left A-pillar**

Qualifier:

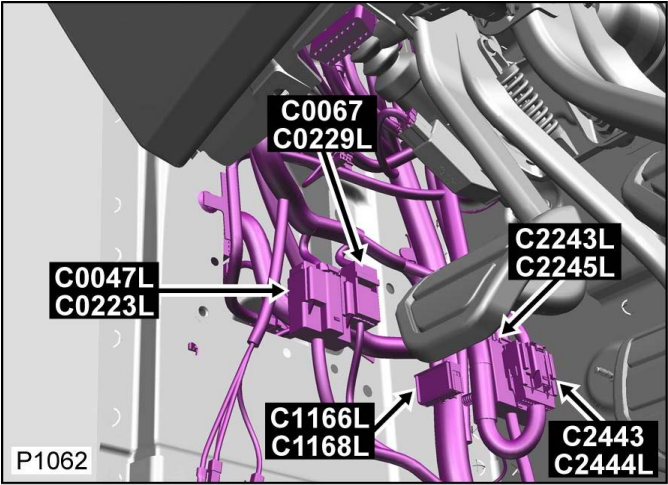

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0D	RW	139L	S/JOINT SJ17	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
2	0.5D	GK	139L	S/JOINT SJ14	-	-	-	-	-	-	-
3	1.5D	GN	125SL	C0396	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
4	1.5D	GW	125SL	C0396	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
9	1.5D	OG	139L	S/JOINT SJ396S	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
10	1.5D	RB	13SL	C0868S	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
11	1.5D	GN	125SL	C0435	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
12	1.5D	GW	125SL	C0435	418-411-16	-	418-116A	418-117	418-104	418-113	418-108