



[Click here to print](#)

Connector: **C0076L**
CONNECTOR HOUSING SERVICEABLE

Description: **Lamp-Footwell-Front-Right**
Location: **Behind RH closing panel**
Qualifier: **LHD condition illustrated**

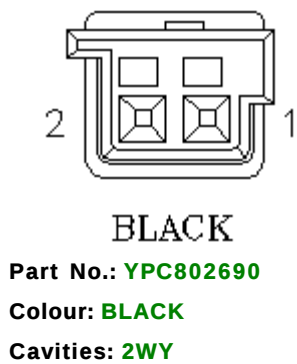

Harness: **FACIA COMPOSITE HARNESS**

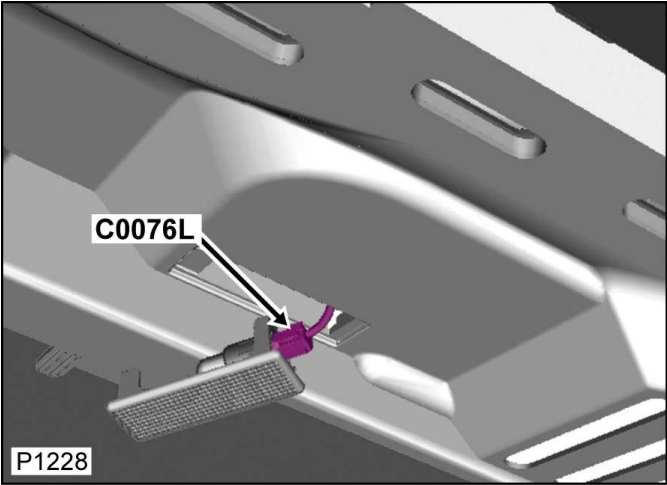

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75D	BK	134L	S/JOINT SJ660	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.75D	VT	134L	S/JOINT SJ740	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107